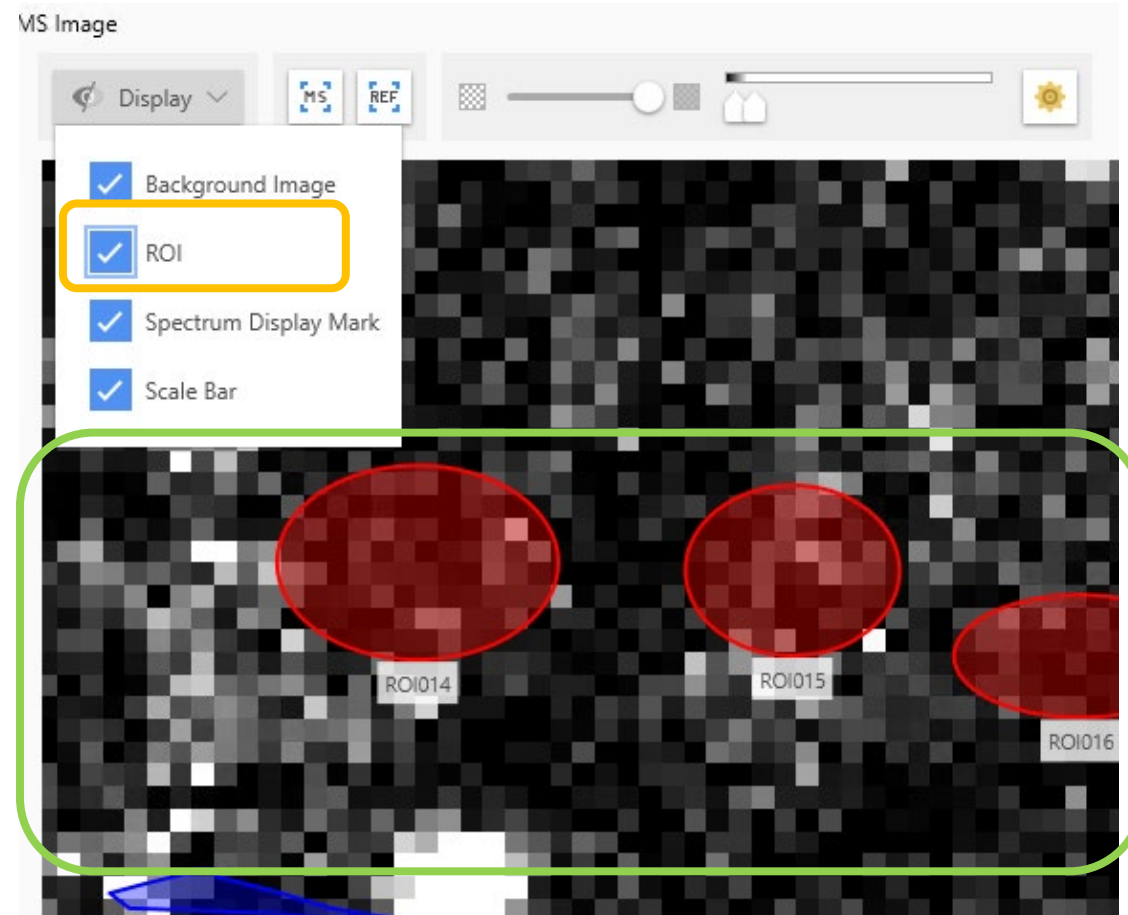# MS image with overlaid ROI

In the MS image display section, select "Display" → "ROI".

You can change the transparency and labeling of the ROI by selecting "Settings" → "ROI".